


## **Appendix D – Public Rights-of-Way Reports**

- **Downtown Core – Curb Ramps**
- **Downtown Core – Driveways**
- **Downtown Core – Parking Lots**

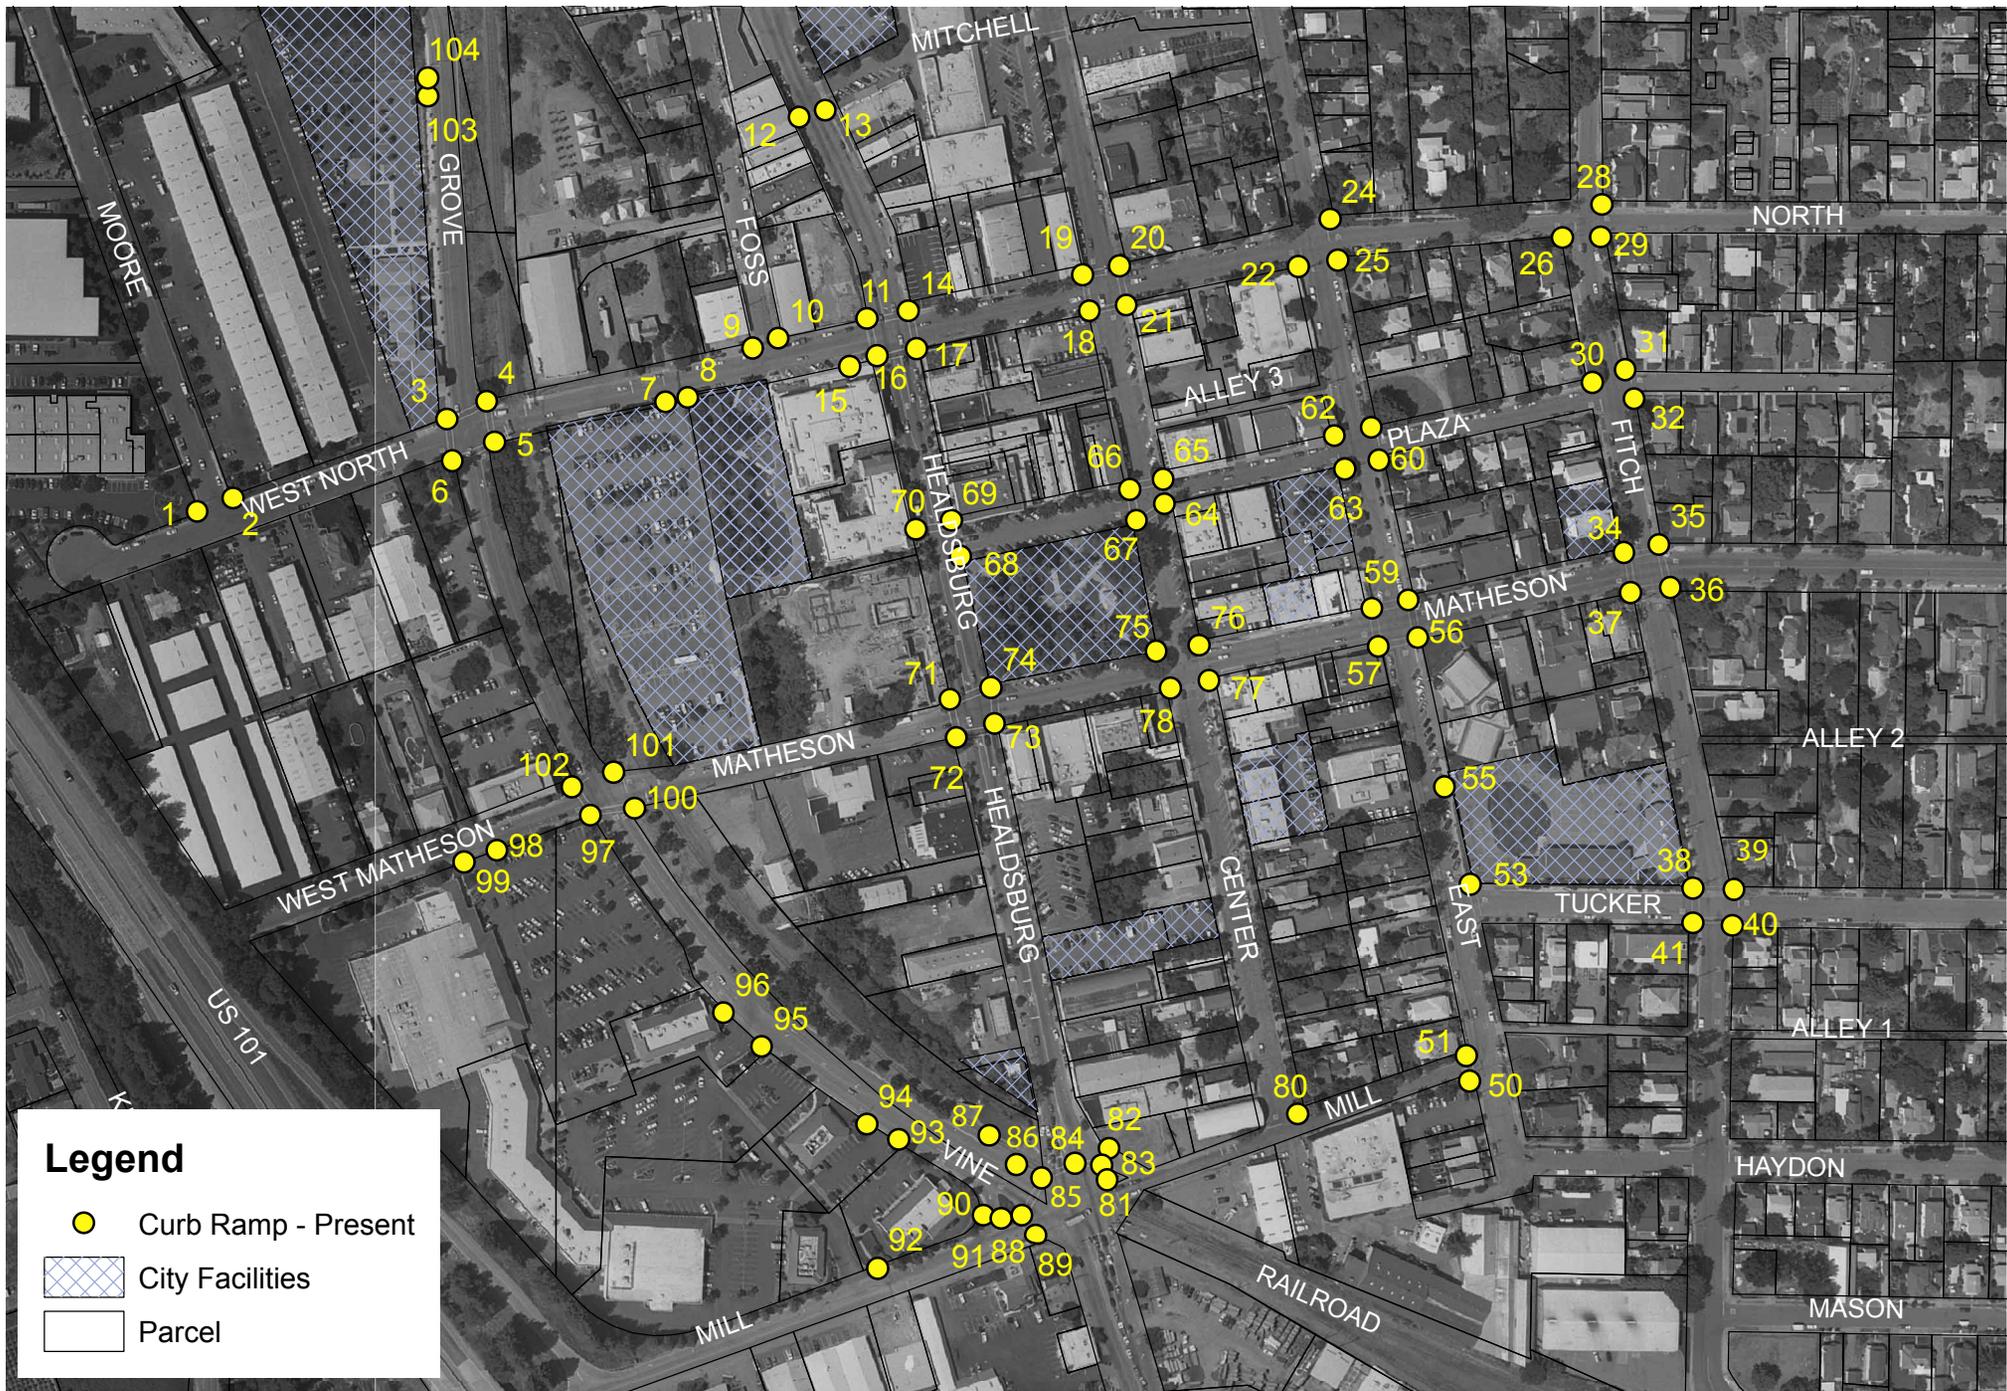

Healdsburg - Downtown Core - Curb Ramps

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 1</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter slope *.3% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Level landing slope 2.5% - 3.6% (2% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>3 - 2</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Flared side 8.9% (8.33% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter slope 8.5% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detecatble warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5		
Federal: -		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>	
<b>3 - 3</b>	<b>Curb Ramp</b> <span style="float: right;">Priority:</span>
<b>Install, replace or modify curb ramp</b>	<b>\$2,500</b>
Notes: Level landing 46" (48" min.), slope 3.5% - 3.9% (2% max.) Flared sides range from 11.8% -19.2% (8.33% max.) Ramp slope 11.4% (8.33% max.) Space at bottom of ramp 36" to traffic lanes (48" min.)	
State: 1127B.5 #3, 1127B.5 #4	
Federal: 4.7.10, 4.8.2	
<b>Provide detectable warning strip</b>	<b>\$1,000</b>
Notes: Detectable warning not provided.	
State: 1127B.5 #7	
Federal: 4.7.7	
<b>Provide surface texturing</b>	<b>\$300</b>
Notes: Curb ramp surface does not contrast with side walks.	
State: 1127B.5 #5	
Federal: -	
<b>3 - 4</b>	<b>Curb Ramp</b> <span style="float: right;">Priority:</span>
<b>Install, replace or modify curb ramp</b>	<b>\$2,500</b>
Notes: Level landing slope 4.1% (2% max.) Flared sides range from 13% -16.6% (8.33% max.) Ramp slope 8.8% near top (8.33% max.) Space at bottom of ramp 38" to traffic lanes (48" min.)	
State: 1127B.5 #3, 1127B.5 #4	
Federal: 4.7.10, 4.8.2	
<b>Repair surface</b>	<b>\$250</b>
Notes: Gutter slope 11.1% (5% max.)	
State: 1127B.5.3	
Federal: 4.7.2	
<b>Provide detectable warning strip</b>	<b>\$1,000</b>
Notes: Detectable warning not provided.	
State: 1127B.5 #7	
Federal: 4.7.7	
<b>Provide surface texturing</b>	<b>\$300</b>
Notes: Grooved border 4" (12" req.) Ramp does not contrast with side walk.	
State: 1127B.5 #5, 1127B.5 #6	
Federal: 4.7.4	

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		Priority:
3 - 5	Curb Ramp	
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing slope 3.2% (2% max.) Space at bottom of ramp 32" to traffic lanes (48" min.)		
State: 1127B.5 #4		
Federal: 4.7.10, 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border 4.5" (12" req.) Ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Repair surface</b>		\$250
Notes: Gutter slope 6.3% (5% max)		
State: 1127B.5.3		
Federal: 4.7.2		
3 - 6	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing slope 3% - 6% (2% max.) Flared sides range from 9.8% -13% (8.33% max.) Ramp slope 9.3% (8.33% max.) Space at bottom of ramp 36" to traffic lanes (48" min.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.7.10, 4.8.2		
<b>Repair surface</b>		\$250
Notes: Gutter slope 8.7% (5.0% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 7	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 39" (48" min.), slope 9.2% (2% max.) Flared sides range from 8.3% - 20.3% (8.33% max.) Ramp slope 9.2% (8.33% max.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.8.2		
<b>Repair surface</b>		\$250
Notes: Gutter slope 5.9% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border 7" (12" req.) Ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
3 - 8	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 46" (48" min.), slope 9.2% (2% max.) Flared sides range from 10.9% - 13.7% (8.33% max.) Ramp slope 9.2% (8.33% max.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.8.2		
<b>Repair surface</b>		\$250
Notes: Gutter slope 10.7% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border 6" (12" req.) Ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 9	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing interrupted by utility pole. Flared sides range from 13.8% -19.2% (8.33% max.) Slope of ramp 22.5% (8.33% max.) Ramp width 36" (48" min.)		
State: 1127B.5 #2, 1127B.5 #3, 1127B.5 #4		
Federal: 4.7.3, 4.8.2		
<b>Repair surface</b>		\$250
Notes: Gutter slope 11.8% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border 10" (12" min.)		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
3 - 10	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 25.5" (48" min.). Flared side 9.2% (8.33% max.) Ramp slope 9.1% (8.33% max.) Space at bottom of ramp 36" to traffic lanes (48" min.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.7.10, 4.8.2		
<b>Repair surface</b>		\$250
Notes: Gutter slope 9.5% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Ramp does not contrast with side walk.		
State: 1127B.5 #5		
Federal: -		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 11</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Level landing slope 4.1% (2% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter slope 10.2% (5% max)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided.		
State: 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 12</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 13</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 14	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Ramp slope 9.4% (8.33% max.) Space at bottom of ramp 40" to traffic lanes (48" min.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.7.10, 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Ramp does not contrast with side walk.		
State: 1127B.5 #5		
Federal: -		
<b>Repair surface</b>		\$250
Notes: Gutter slope 11.4% (5% max.) Gutter lip 3/4" (1/2" max.)		
State: 1127B.5.3		
Federal: 4.7.2		
3 - 15	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 36" (48" min.). Flared sides range from 11% -15.6% (8.33% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Repair surface</b>		\$250
Notes: Gutter slope 6.3% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detecable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Ramp does not contrast with side walk.		
State: 1127B.5 #5		
Federal: -		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 16	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing slope 2.6% (2% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided.		
State: 1127B.5 #6		
Federal: 4.7.4		
3 - 17	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing slope 2.8% (2% max.) Ramp slope 10.7% (8.33% max.) Space at bottom of ramp 24" to traffic lanes (48" min.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.7.10, 4.8.2		
<b>Repair surface</b>		\$250
Notes: Gutter slope 9.8% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Ramp does not contrast with side walk.		
State: 1127B.5 #5		
Federal: -		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>	
<b>3 - 18</b>	<b>Curb Ramp</b> <span style="float: right;">Priority:</span>
<b>Install, replace or modify curb ramp</b>	<b>\$2,500</b>
Notes: No level landing due to tree well. Space at bottom of ramp 36" to traffic lanes (48" min.)	
State: 1127B.5 #4	
Federal: 4.7.10, 4.8.2	
<b>Provide detectable warning strip</b>	<b>\$1,000</b>
Notes: Detectable warning not provided.	
State: 1127B.5 #7	
Federal: 4.7.7	
<b>Provide surface texturing</b>	<b>\$300</b>
Notes: Grooved border not provided. Ramp does not contrast with side walk.	
State: 1127B.5 #5, 1127B.5 #6	
Federal: 4.7.4	
<b>3 - 19</b>	<b>Curb Ramp</b> <span style="float: right;">Priority:</span>
<b>Install, replace or modify curb ramp</b>	<b>\$0</b>
Notes: Vendor display blocking level landing. Space at bottom of ramp 32" to traffic lanes (48" min.)	
State: 1127B.5 #4	
Federal: 4.7.10, 4.8.2	
<b>Provide detectable warning strip</b>	<b>\$1,000</b>
Notes: Detectable warning not provided.	
State: 1127B.5 #7	
Federal: 4.7.7	
<b>Provide surface texturing</b>	<b>\$300</b>
Notes: Grooved border not provided. Ramp does not contrast with side walk.	
State: 1127B.5 #5, 1127B.5 #6	
Federal: 4.7.4	
<b>Repair surface</b>	<b>\$250</b>
Notes: Gutter lip 3/4" (1/2" max.)	
State: 1127B.5.3	
Federal: 4.7.2	

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		Priority:
<b>3 - 20</b>	<b>Curb Ramp</b>	
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing slope 3.2% (2% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 21</b>	<b>Curb Ramp</b>	Priority:
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 22</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Flared sides range from 8.5% -10.2% (8.33% max.) Ramp slope 11.4% (8.33% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border 5.5" (12" min.). Ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 23</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 36" (48" min.)		
State: 1127B.5 #4		
Federal: 4.8.2		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 24	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing slope 3.4% (2% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
3 - 25	Curb Ramp	Priority:
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. (Curb ramp might could be considered a walk.)		
State: 1127B.5 #6		
Federal: 4.7.4		
3 - 26	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing slope 4.2% (2% max.) Flared sides range from 7.5-12.2% (8.33% max.) Ramp slope 10.6% (8.33% max.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp does not contrast with side walk.		
State: 1127B.5 #5		
Federal: -		
3 - 27	Curb Ramp	Priority:
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided.		
State: 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 28	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 36" (48" min.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Repair surface</b>		\$250
Notes: Gutter Slope 8.5% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
3 - 29	Curb Ramp	Priority:
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
3 - 30	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 35" (48" min.), Flared sides range from 5.5% - 11.6% (8.33% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp does not contrast with side walk.		
State: 1127B.5 #5		
Federal: -		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 31</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Level landing not provided.		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter lip 3/4" (1/2" max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 32</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Level landing not provided.		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 33</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Curb ramp not provided.		
State: 1127B.5 #3		
Federal: 4.8.2		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior	
<b>3 - 34</b>	<b>Curb Ramp</b> Priority:
<b>Install, replace or modify curb ramp</b>	\$2,500
Notes:	Level landing 36" (48" min.)
State:	1127B.5 #4
Federal:	4.8.2
<b>3 - 35</b>	<b>Curb Ramp</b> Priority:
<b>Install, replace or modify curb ramp</b>	\$2,500
Notes:	Level landing 36" (48" min.)
State:	1127B.5 #4
Federal:	4.8.2
<b>Repair surface</b>	\$250
Notes:	Gutter Slope 5.5% (5% max.)
State:	1127B.5.3
Federal:	4.7.2
<b>3 - 36</b>	<b>Curb Ramp</b> Priority:
<b>Provide surface texturing</b>	\$300
Notes:	Curb ramp does not contrast with side walk.
State:	1127B.5 #6
Federal:	4.7.4
<b>3 - 37</b>	<b>Curb Ramp</b> Priority:
<b>Install, replace or modify curb ramp</b>	\$2,500
Notes:	Level landing 32-1/2" (48" min.)
State:	1127B.5 #4
Federal:	4.8.2
<b>3 - 38</b>	<b>Curb Ramp</b> Priority:
<b>Install, replace or modify curb ramp</b>	\$2,500
Notes:	Level landing slope 4.3% - 3.9% (2% max.) Curb ramp slope 8.9% (8.33% max.)
State:	1127B.5 #3, 1127B.5 #4
Federal:	4.8.2
<b>Provide detectable warning strip</b>	\$1,000
Notes:	Detectable warning not provided.
State:	1127B.5 #7
Federal:	4.7.7
<b>Provide surface texturing</b>	\$300
Notes:	Grooved border 4" (12" min.). Curb ramp does not contrast with side walk.
State:	1127B.5 #5, 1127B.5 #6
Federal:	4.7.4

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 39	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 29" (48" min.) Flared sides range from 11% -12.2% (8.33% max.) Curb ramp slope 10.6% (8.33% max.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border 4" (12" min.). Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
3 - 40	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 15" (48" min.), slope 3.8% (2% max.) Flared sides range from 13% - 14.4% (8.33% max.) Curb ramp slope 11.4% (8.33% max.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border 4" (12" min.). Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 41	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 33" (48" min.) Flared sides range from 5.4% -10.8% (8.33% max.) Curb ramp slope 10.1% (8.33% max.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border 4" (12" min.). Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
3 - 42	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp not provided.		
State: 1127B.5 #3		
Federal: 4.8.2		
3 - 43	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp not provided.		
State: 1127B.5 #3		
Federal: 4.8.2		
3 - 44	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp not provided.		
State: 1127B.5 #3		
Federal: 4.8.2		
3 - 45	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp not provided.		
State: 1127B.5 #3		
Federal: 4.8.2		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
<b>3 - 46</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp not provided.		
State: 1127B.5 #3		
Federal: 4.8.2		
<b>3 - 47</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp not provided.		
State: 1127B.5 #3		
Federal: 4.8.2		
<b>3 - 48</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp not provided.		
State: 1127B.5 #3		
Federal: 4.8.2		
<b>3 - 49</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp not provided.		
State: 1127B.5 #3		
Federal: 4.8.2		
<b>3 - 50</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp slope 9.1% (8.33% max.)		
State: 1127B.5 #3		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 51	Curb Ramp	Priority:
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk. (Curb ramp might be considered a walk.)		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided. (Curb ramp might be considered a walk.)		
State: 1127B.5 #7		
Federal: 4.7.7		
3 - 52	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp not provided.		
State: 1127B.5 #3		
Federal: 4.8.2		
3 - 53	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp slope 9.1% (8.33% max.)		
State: 1127B.5 #3		
Federal: 4.8.2		
<b>Repair surface</b>		\$250
Notes: Gutter Slope 6.7% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp does not contrast with side walk.		
State: 1127B.5 #5		
Federal: -		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		Priority:
<b>3 - 54</b>	<b>Curb Ramp</b>	
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Level landing 35-1/2" (48" min.), Flared side 13% (8.33% max.) Curb ramp slope 10.3% (8.33% max.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 55</b>	<b>Curb Ramp</b>	
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Curb ramp slope 9.1% (8.33% max.)		
State: 1127B.5 #3		
Federal: 4.8.2		
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter Slope 5.7% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 57</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing slope 2.6% (2% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided.		
State: 1127B.5 #5		
Federal: -		
<b>3 - 58</b>	<b>Curb Ramp</b>	Priority:
<b>Repair surface</b>		\$250
Notes: Gutter Slope 5.4% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>3 - 60</b>	<b>Curb Ramp</b>	Priority:
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 61</b>	<b>Curb Ramp</b>	Priority:
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp does not contrast with side walk.		
State: 1127B.5 #5		
Federal: -		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 62</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing 36" (48" min.), slope 5.8% (2% max.) Flared sides range from 14.5% - 15.8% (8.33% max.) Curb ramp slope 10% (8.33% max.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.8.2		
<b>Repair surface</b>		\$250
Notes: Gutter lip 3/4" (1/2" max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp does not contrast with side walk.		
State: 1127B.5 #5		
Federal: -		
<b>3 - 63</b>	<b>Curb Ramp</b>	Priority:
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp does not contrast with side walk.		
State: 1127B.5 #5		
Federal: -		
<b>3 - 64</b>	<b>Curb Ramp</b>	Priority:
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 65	Curb Ramp	Priority:
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
3 - 66	Curb Ramp	Priority:
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
3 - 67	Curb Ramp	Priority:
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
3 - 68	Curb Ramp	Priority:
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		Priority:
<b>3 - 69</b>	<b>Curb Ramp</b>	
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 70</b>	<b>Curb Ramp</b>	
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 71</b>	<b>Curb Ramp</b>	
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Repair surface</b>		\$250
Notes: Gutter Slope 5.6% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 72</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter Slope 5.3% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>3 - 73</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter Slope 7.4% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 74</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter Slope 6.5% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>3 - 75</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter Slope 6.0% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 76</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter Slope 15.8% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 77</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Repair surface</b>		<b>\$250</b>
Notes: Gutter Slope 8.7% (5% max.)		
State: 1127B.5.3		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp does not contrast with side walk.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 78</b>	<b>Curb Ramp</b>	Priority:
<b>Repair surface</b>		\$250
Notes:	Gutter Slope 15.4% (5% max.)	
State:	1127B.5.3	
Federal:	4.7.2	
<b>Provide detectable warning strip</b>		\$1,000
Notes:	Detectable warning not provided.	
State:	1127B.5 #7	
Federal:	4.7.7	
<b>Provide surface texturing</b>		\$300
Notes:	Grooved border not provided. Curb ramp does not contrast with side walk.	
State:	1127B.5 #5, 1127B.5 #6	
Federal:	4.7.4	
<b>3 - 79</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes:	Curb ramp not provided.	
State:	1127B.5 #3	
Federal:	4.8.2	
<b>3 - 80</b>	<b>Curb Ramp</b>	Priority:
<b>Provide surface texturing</b>		\$300
Notes:	Grooved border not provided. Curb ramp does not contrast with side walk.	
State:	1127B.5 #5, 1127B.5 #6	
Federal:	4.7.4	
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes:	Level landing 29" (48" min.) Flared sides range from 17.4% -18.9% (8.33% max.) Curb ramp slope 18.9% (8.33% max.)	
State:	1127B.5 #3, 1127B.5 #4	
Federal:	4.8.2	
<b>Provide detectable warning strip</b>		\$1,000
Notes:	Detectable warning not provided.	
State:	1127B.5 #7	
Federal:	4.7.7	
<b>Repair surface</b>		\$250
Notes:	Gutter Slope 6.9% (5% max.)	
State:	1127B.5.3	
Federal:	4.7.2	

## Healdsburg

### Downtown Core - Curb Ramps

Exterior		
3 - 81	Curb Ramp	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Parallel curb ramp slope (one side) 9.0% (8.33% max.) Gutter Slope 13% (5% max.)		
State: 1127B.5 #3		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5		
Federal: -		
3 - 82	Curb Ramp	Priority:
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5		
Federal: -		
3 - 83	Curb Ramp	Priority:
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5		
Federal: -		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 84</b>	<b>Curb Ramp</b>	Priority:
<b>Provide detectable warning strip</b>		\$1,000
Notes: Grooved border not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5		
Federal: -		
<b>3 - 85</b>	<b>Curb Ramp</b>	Priority:
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5		
Federal: -		
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp width 47-1/2" (48" min.)		
State: 1127B.5 #2		
Federal: 4.7.3		
<b>3 - 86</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Curb ramp slope 8.7% (8.33% max.)		
State: 1127B.5 #3		
Federal: 4.8.2		
<b>3 - 87</b>	<b>Curb Ramp</b>	Priority:
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 88</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Note: Total of two curb ramps present each with the same issues. Curb ramp slope 8.6% (8.33% max.) Curb ramp width 36" (48" max.) Flared sides 15.7% - 13.8%. Level landing slope 8.3% (2% max.)		
State: 1127B.5 #2, 1127B.5 #3, 1127B.5 #4		
Federal: 4.7.3, 4.7.5, 4.8.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 89</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Cross slope 3.0% (2.0% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>	
<b>3 - 90</b>	<b>Curb Ramp</b> <span style="float: right;">Priority:</span>
<b>Install, replace or modify curb ramp</b>	<b>\$2,500</b>
Notes: Curb ramp slope 8.5% (8.33% max.) Level landing slope 6.6% (2% max.) Flared sides 15.3% - 11.2% (8.33% max.).	
State: 1127B.5 #3, 1127B.5 #4	
Federal: 4.7.5, 4.8.2	
<b>Provide detectable warning strip</b>	<b>\$1,000</b>
Notes: Detectable warning not provided.	
State: 1127B.5 #7	
Federal: 4.7.7	
<b>Provide surface texturing</b>	<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.	
State: 1127B.5 #5, 1127B.5 #6	
Federal: 4.7.4	
<b>3 - 91</b>	<b>Curb Ramp</b> <span style="float: right;">Priority:</span>
<b>Provide surface texturing</b>	<b>\$300</b>
Notes: Curb ramp surface material does not contrast with sidewalks. Grooved border not provided.	
State: 1127B.5 #5, 1127B.5 #6	
Federal: 4.7.4	
<b>Install, replace or modify curb ramp</b>	<b>\$2,500</b>
Notes: Curb ramp slope 10.9% (8.33% max.) Curb ramp width 42" (48" min.) Flared sides 10.6% - 11.8% (8.33% max.).	
State: 1127B.5 #2, 1127B.5 #3	
Federal: 4.7.3, 4.7.5, 4.8.2	
<b>Provide detectable warning strip</b>	<b>\$1,000</b>
Notes: Detectable warning not provided.	
State: 1127B.5 #7	
Federal: 4.7.7	

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 92</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Curb ramp slope 9.7% (8.33% max.) Gutter slope 7.1% (5% max.) Flared sides 11.2% - 13.6% (8.33% max.). Curb ramp width 36" (48" min.) Level landing 42" wide (48" min.), slope 6.8% (2% max.)		
State: 1127B.5 #3		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 93</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Curb ramp slope 10.2% (8.33% max.) Flared sides 12.4% - 12.7% (10.0% max.) Curb ramp width 36" (48" min.)		
State: 1127B.5 #2, 1127B.5 #3, 1127B.5 #4		
Federal: 4.7.3, 4.7.5, 4.8.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>	
<b>3 - 94</b>	<b>Curb Ramp</b> <span style="float: right;">Priority:</span>
<b>Provide surface texturing</b>	<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.	
State: 1127B.5 #5, 1127B.5 #6	
Federal: 4.7.4	
<b>Install, replace or modify curb ramp</b>	<b>\$2,500</b>
Notes: Flared sides 9.4% - 11.1% (10.0% max.) Curb ramp width 36" (48" min.) Level landing slope 2.6% (2% max.)	
State: 1127B.5 #2, 1127B.5 #3	
Federal: 4.7.3, 4.7.5, 4.8.2	
<b>Provide detectable warning strip</b>	<b>\$1,000</b>
Notes: Detectable warning not provided.	
State: 1127B.5 #7	
Federal: 4.7.7	
<b>3 - 95</b>	<b>Curb Ramp</b> <span style="float: right;">Priority:</span>
<b>Provide surface texturing</b>	<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.	
State: 1127B.5 #5, 1127B.5 #6	
Federal: 4.7.4	
<b>Install, replace or modify curb ramp</b>	<b>\$2,500</b>
Notes: Curb ramp slope 11.5% (8.33% max.) Flared sides 23.7% - 15.7% (10.0% max.) Curb ramp width 36" (48" min.) Level landing slope 3.2% (2% max.)	
State: 1127B.5 #2, 1127B.5 #3	
Federal: 4.7.3, 4.7.5, 4.8.2	
<b>Provide detectable warning strip</b>	<b>\$1,000</b>
Notes: Detectable warning not provided.	
State: 1127B.5 #7	
Federal: 4.7.7	

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 96</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Curb ramp slope 12.7% (8.33% max.) Flared sides 20.1% - 19.1% (10.0% max.) Curb ramp width 36" (48" min.) Level landing slope 4.9% (2% max.)		
State: 1127B.5 #2, 1127B.5 #3		
Federal: 4.7.3, 4.7.5, 4.8.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>3 - 97</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Curb ramp slope 11.4% (8.33% max.) Flared sides 15.1% - 11.0% (10.0% max.) Curb ramp width 36" (48" min.) Level landing slope 3.4% (2% max.)		
State: 1127B.5 #2, 1127B.5 #3		
Federal: 4.7.3, 4.7.5, 4.8.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 98</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Provide surface texturing</b>		<b>\$300</b>
Notes:	Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.	
State:	1127B.5 #5, 1127B.5 #6	
Federal:	4.7.4	
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes:	Curb ramp slope 11.5% (8.33% max.) Flared sides 17.9% - 14.0% (10.0% max.) Curb ramp width 36" (48" min.) Level landing slope 3.8% (2% max.)	
State:	1127B.5 #2, 1127B.5 #3	
Federal:	4.7.3, 4.7.5, 4.8.2	
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes:	Detectable warning not provided.	
State:	1127B.5 #7	
Federal:	4.7.7	
<b>3 - 99</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Provide surface texturing</b>		<b>\$300</b>
Notes:	Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.	
State:	1127B.5 #5, 1127B.5 #6	
Federal:	4.7.4	
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes:	Curb ramp slope 8.8% (8.33% max.) Flared sides 15.2% - 11.6% (10.0% max.) Curb ramp width 36" (48" min.)	
State:	1127B.5 #2, 1127B.5 #3	
Federal:	4.7.3, 4.7.5, 4.8.2	
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes:	Detectable warning not provided.	
State:	1127B.5 #7	
Federal:	4.7.7	

## Healdsburg


### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 100</b>	<b>Curb Ramp</b>	Priority:
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Flared sides 11.2% - 9.5% (10.0% max.) Level landing slope 2.5% (2% max.) Gutter slope 7.5% (5% max.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.7.5, 4.8.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>3 - 101</b>	<b>Curb Ramp</b>	Priority:
<b>Provide surface texturing</b>		\$300
Notes: Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5		
Federal: -		
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Flared sides 16.1% - 7.5% (10.0% max.) Gutter slope 10.0% (5% max.) Level landing slope 2.5% (2% max.)		
State: 1127B.5 #3, 1127B.5 #4		
Federal: 4.7.5, 4.8.2		
<b>3 - 102</b>	<b>Curb Ramp</b>	Priority:
<b>Provide surface texturing</b>		\$300
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>Install, replace or modify curb ramp</b>		\$2,500
Notes: Level landing slope 4.2% (2% max.) Gutter slope 5.4% (5% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Repair surface</b>		\$250
Notes: Lip at gutter 1/2".		
State: 1133B.7.4		
Federal: 4.7.2		
<b>Provide detectable warning strip</b>		\$1,000
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		

## Healdsburg

### Downtown Core - Curb Ramps

<b>Exterior</b>		
<b>3 - 103</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Level landing slope 3.0% (2% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		
<b>3 - 104</b>	<b>Curb Ramp</b>	<b>Priority:</b>
<b>Install, replace or modify curb ramp</b>		<b>\$2,500</b>
Notes: Level landing slope 3.4% (2% max.)		
State: 1127B.5 #4		
Federal: 4.8.2		
<b>Provide detectable warning strip</b>		<b>\$1,000</b>
Notes: Detectable warning not provided.		
State: 1127B.5 #7		
Federal: 4.7.7		
<b>Provide surface texturing</b>		<b>\$300</b>
Notes: Grooved border not provided. Curb ramp surface material does not contrast with sidewalks.		
State: 1127B.5 #5, 1127B.5 #6		
Federal: 4.7.4		

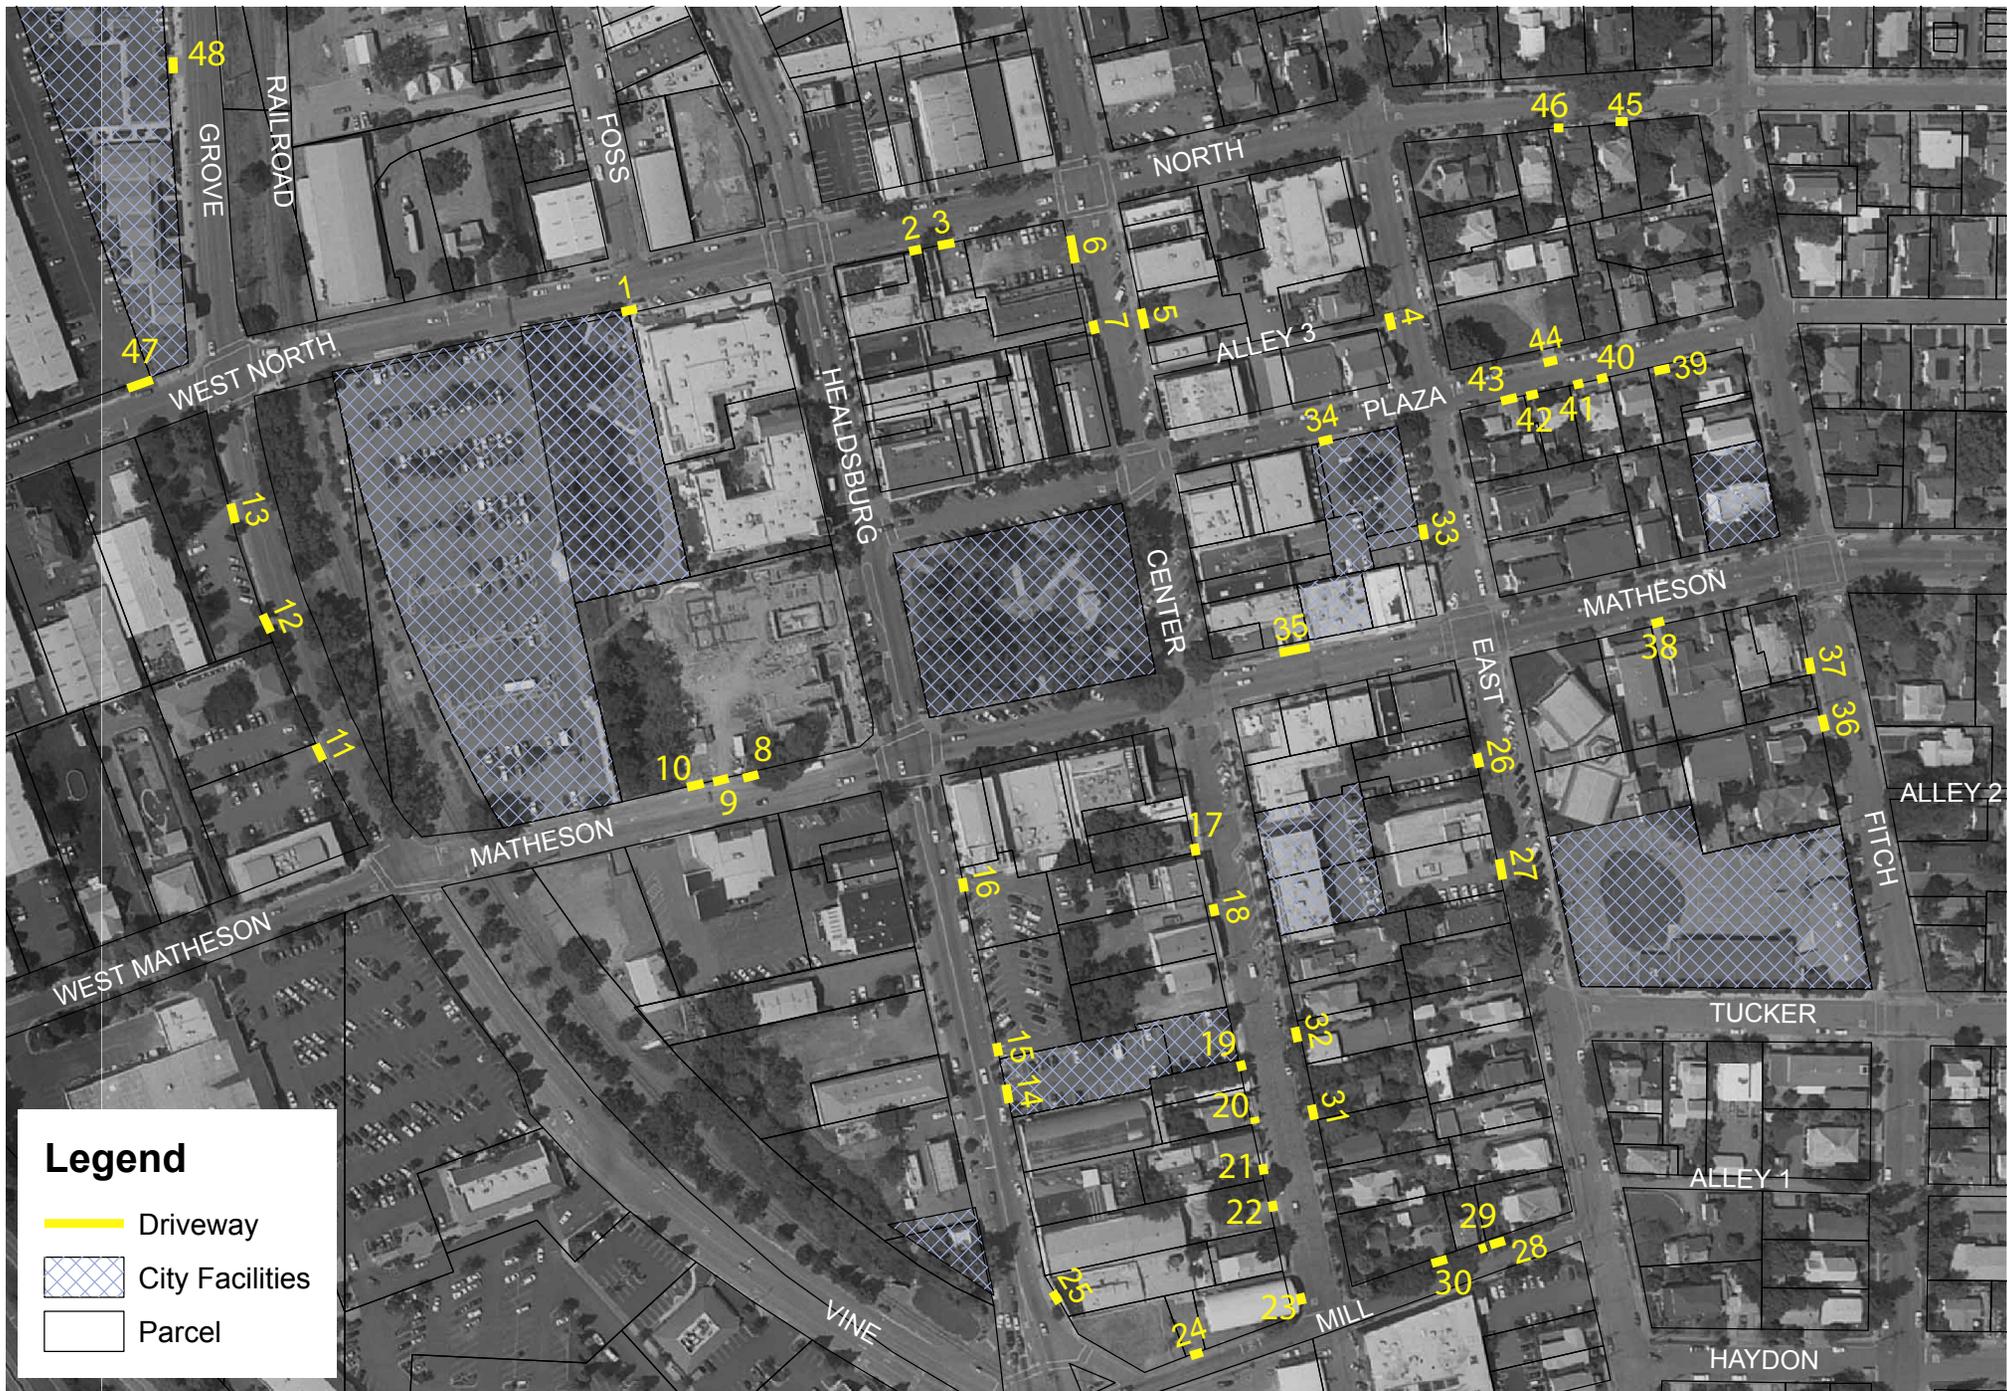

**Healdsburg - Downtown Core - Driveways**

## Healdsburg

### Downtown Core - Driveways

<b>4 - 1</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$11,280</b>
Notes: Cross Slope 6.5% (2.0% max.) Width 282". Length 152". APN#002-182-033.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 2</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$9,680</b>
Notes: Cross Slope 10.6% (2.0% max.) Width 242". Length 104". APN#002-182-015.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 3</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$14,840</b>
Notes: Cross Slope 9.7% (2.0% max.) Width 371". Length 85". Sidewalk present, Slope 8.9% (2.0% max.) APN#002-182-016.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 4</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$6,320</b>
Notes: Cross Slope 5.4% (2.0% max.) Width 158". Length 310". Alley 3.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 5</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$10,560</b>
Notes: Cross Slope 15.3% (2.0% max.) Width 264". Length 50". Sidewalk present, Slope 5.6% (2.0% max.) APN#002-193-015.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 6</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$15,720</b>
Notes: Cross Slope 7.9% (2.0% max.) Width 393". Length 77". APN#002-181-013.		
State: 1133B.7.1.3		
Federal: 4.3.7		

## Healdsburg

### Downtown Core - Driveways

<b>4 - 7</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$7,920</b>
Notes: Cross Slope 13.5% (2.0% max.) Width 198". Length 45". Sidewalk present, Slope 3.5% (2.0% max.) APN#002-182-000.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 8</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$10,200</b>
Notes: Cross Slope 15.5% (2.0% max.) Width 255". Length 28". Sidewalk present, Slope 3.3% (2.0% max.) APN#002-182-032.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 9</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$8,360</b>
Notes: Cross Slope 16.6% (2.0% max.) Width 209". Length 37". Sidewalk present, Slope 2.8% (2.0% max.) APN#002-182-032.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 10</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$8,280</b>
Notes: Cross Slope 16.6% (2.0% max.) Width 207". Length 38". Sidewalk present, Slope 2.4% (2.0% max.) APN#002-182-032.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 11</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$11,840</b>
Notes: Cross Slope 4.2% (2.0% max.) Width 296". Length 79". APN#088-230-078.		
State: 1133B.7.1.3		
Federal: 4.3.7		

## Healdsburg

### Downtown Core - Driveways

<b>4 - 12</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$11,960</b>
Notes:	Cross Slope 8.9% (2.0% max.) Width 299". Length 66". APN#088-230-069.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 13</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$12,000</b>
Notes:	Cross Slope 10.6% (2.0% max.) Width 300". Length 60". APN#088-230-069.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 14</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$11,440</b>
Notes:	Cross Slope 5.9% (2.0% max.) Width 286". Length 94". APN#002-242-038.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 15</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$12,280</b>
Notes:	Cross Slope 5.8% (2.0% max.) Width 307". Length 98". APN#002-242-006.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 16</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$12,000</b>
Notes:	Cross Slope 7.0% (2.0% max.) Width 300". Length 96". APN#002-242-047.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 17</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$9,320</b>
Notes:	Cross Slope 8.3% (2.0% max.) Width 233". Length 113". APN#002-242-022.	
State:	1133B.7.1.3	
Federal:	4.3.7	

## Healdsburg

### Downtown Core - Driveways

<b>4 - 18</b>	<b>Walk</b>	<b>Priority:</b>
<b>Regrade surface</b>		<b>\$9,880</b>
Notes: Cross Slope 3.8% (2.0% max.) Width 247". Length 41". Sidewalk present, Slope 3.8% (2.0% max.) APN#002-242-014.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 19</b>	<b>Walk</b>	<b>Priority:</b>
<b>Regrade surface</b>		<b>\$5,760</b>
Notes: Cross Slope 3.8% (2.0% max.) Width 144". Length 66". APN#002-242-018.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 20</b>	<b>Walk</b>	<b>Priority:</b>
<b>Regrade surface</b>		<b>\$4,800</b>
Notes: Cross Slope 13.0% (2.0% max.) Width 120". Length 61". Sidewalk present, but only 36" wide (48" min.) APN#002-242-019.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 21</b>	<b>Walk</b>	<b>Priority:</b>
<b>Regrade surface</b>		<b>\$6,040</b>
Notes: Cross Slope 3.5% (2.0% max.) Width 151". Length 64". Sidewalk present. APN#002-242-020.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 22</b>	<b>Walk</b>	<b>Priority:</b>
<b>Regrade surface</b>		<b>\$8,280</b>
Notes: Cross Slope 13.8% (2.0% max.) Width 207". Length 70". Sidewalk present, but only 36" wide (48" min.) APN#002-242-002.		
State: 1133B.7.1.3		
Federal: 4.3.7		

## Healdsburg

### Downtown Core - Driveways

<b>4 - 23</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$9,200</b>
Notes: Cross Slope 5.8% (2.0% max.) Width 230". Length 60". Bike racks blocking PROW. APN#002-242-053.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 24</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$13,120</b>
Notes: Cross Slope 2.5% (2.0% max.) Width 328". Length 45". APN#002-242-054.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 25</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$8,800</b>
Notes: Cross Slope 2.5% (2.0% max.) Width 328". Length 45". Sidewalk present, but store display obstructs PROW. APN#002-242-028.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 26</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$12,280</b>
Notes: Cross Slope 6.5% (2.0% max.) Width 307". Length 120". APN#002-241-036.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 27</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$7,200</b>
Notes: Cross Slope 2.9% (2.0% max.) Width 180". Length 76". APN#002-241-017.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 28</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$8,680</b>
Notes: Cross Slope 11.0% (2.0% max.) Width 217". Length 70". APN#002-241-024.		
State: 1133B.7.1.3		
Federal: 4.3.7		

## Healdsburg

### Downtown Core - Driveways

<b>4 - 29</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$6,240</b>
Notes:	Cross Slope 8.6% (2.0% max.) Width 156". Length 64". APN#002-241-025.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 30</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$7,920</b>
Notes:	Cross Slope 10.2% (2.0% max.) Width 198". Length 66". APN#002-241-001.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 31</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$5,320</b>
Notes:	Cross Slope 9.1% (2.0% max.) Width 133". Length 91". APN#002-241-003.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 32</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$7,960</b>
Notes:	Cross Slope 8.5% (2.0% max.) Width 199". Length 96". APN#002-241-004.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 33</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$14,400</b>
Notes:	Cross Slope 12.0% (2.0% max.) Width 360". Length 55". APN#002-194-015.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 34</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$12,680</b>
Notes:	Cross Slope 12.3% (2.0% max.) Width 317". Length 58". APN#002-194-017.	
State:	1133B.7.1.3	
Federal:	4.3.7	

## Healdsburg

### Downtown Core - Driveways

<b>4 - 35</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$22,280</b>
Notes:	Cross Slope 10.5% (2.0% max.) Width 557". Length 83". Sidewalk present, slope 2.9% (2.0% max.) APN#002-194-023.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 36</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$9,000</b>
Notes:	Cross Slope 3.5% (2.0% max.) Width 225". Length 65". Sidewalk present. APN#002-232-006.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 37</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$40,800</b>
Notes:	Cross Slope 8.6% (2.0% max.) Width 1020". Length 63". Sidewalk present. APN#002-232-014.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 38</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$11,880</b>
Notes:	Cross Slope 3.5% (2.0% max.) Width 297". Length 68". Sidewalk present. APN#002-232-002.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 39</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$6,880</b>
Notes:	Cross Slope 2.3% (2.0% max.) Width 172". Length 576". Sidewalk present. APN#002-191-012.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 40</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$6,640</b>
Notes:	Cross Slope 8.1% (2.0% max.) Width 166". Length 80". APN#002-191-014.	
State:	1133B.7.1.3	
Federal:	4.3.7	

## Healdsburg

### Downtown Core - Driveways

<b>4 - 41</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$6,080</b>
Notes:	Cross Slope 10.8% (2.0% max.) Width 152". Length 54". APN#002-191-014.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 42</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$8,240</b>
Notes:	Cross Slope 5.9% (2.0% max.) Width 206". Length 54". APN#002-191-017.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 43</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$12,760</b>
Notes:	Cross Slope 9.2% (2.0% max.) Width 319". Length 56". APN#002-191-016.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 44</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$10,520</b>
Notes:	Cross Slope 3.3% (2.0% max.) Width 293". Length 79". APN#002-192-001.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 45</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$5,000</b>
Notes:	Cross Slope 17.5% (2.0% max.) Width 125". Length 46". Sidewalk present, but only 36" wide (48" min.) APN#002-192-007.	
State:	1133B.7.1.3	
Federal:	4.3.7	
<b>4 - 46</b>	<b>Walk</b>	Priority:
<b>Regrade surface</b>		<b>\$4,240</b>
Notes:	Cross Slope 3.6% (2.0% max.) Width 106". Length 49". Sidewalk present. APN#002-192-006.	
State:	1133B.7.1.3	
Federal:	4.3.7	

**Healdsburg**

Downtown Core - Driveways

<b>4 - 47</b>	<b>Walk</b>	<b>Priority:</b>
<b>Regrade surface</b>		<b>\$18,640</b>
Notes: Cross Slope 3.8% (2.0% max.) Width 466". Length 108". APN#088-230-060.		
State: 1133B.7.1.3		
Federal: 4.3.7		
<b>4 - 48</b>	<b>Walk</b>	<b>Priority:</b>
<b>Regrade surface</b>		<b>\$13,920</b>
Notes: Cross Slope 2.5% (2.0% max.) Width 348". Length 54". Sidewalk present. APN#088-230-062.		
State: 1133B.7.1.3		
Federal: 4.3.7		



Healdsburg and Mitchell Parking Lot  
Healdsburg, CA

## Healdsburg

Healdsburg and Mitchell Parking Lot

<b>Exterior</b>	
<b>1 - 1</b>	<b>Parking Area</b> <span style="float: right;">Priority:</span>
<b>Install van parking sign</b>	<b>\$250</b>
Notes: Van accessible sign is not provided.	
State: 1129B.4	
Federal: 4.6.4	
<b>Install sign</b>	<b>\$250</b>
Notes: The words "No Parking" are not painted in the access aisle. \$250 fine sign is not provided.	
State: 1129B.3 #1, 1129B.3 #2, 1129B.4	
Federal: -	
<b>Install sign for unauthorized parking</b>	<b>\$400</b>
Notes: Warning sign is not provided at parking lot entrance.	
State: 1129B.4, 1133B.8.6.3	
Federal: -	
<b>Provide or modify accessible spaces</b>	<b>\$500</b>
Notes: Stall width is 16'-0" (18' min.) There is 1 disabled space for 26 spaces. (25 spaces max.)	
State: 1129B, 1129B.4 #1	
Federal: 4.1.2(5)(b), 4.6.3	
<b>Provide or modify accessible access aisles</b>	<b>\$150</b>
Notes: Adjacent access aisle is on driver's side (Passenger side required). Van access aisle is 60" (96" min).	
State: 1129B.3 #1, 1129B.3 #2, 1129B.4 #1	
Federal: 4.6.3	



Plaza and East Street Parking Lot  
Healdsburg, CA

## Healdsburg

Plaza and East Parking Lot

Exterior		
1 - 1	Parking Area	Priority:
<b>Provide or modify accessible spaces</b>		\$2,550
Notes: There are a total of 49 parking spaces and 1 accessible parking space. Provide 1 additional accessible parking space. Accessible space is closest to the senior center.		
State: 1129B, 1129B.1		
Federal: 4.1.2(5)(b), 4.6.2		



Plaza Parking Lot  
Healdsburg Avenue and Center Street  
Healdsburg, CA

**Healdsburg**  
Plaza Park Parking Lot

<b>Exterior</b>	
<b>1 - 1</b>	<b>Parking Area</b> <span style="float: right;">Priority:</span>
<b>Install sign</b>	<b>\$200</b>
Notes: The words 'NO PARKING' are not provided in the 4 access aisles.	
State: 1129B.3 #1, 1129B.3 #2	
Federal: -	
<b>Install sign</b>	<b>\$400</b>
Notes: Additional signage stating "Minimum Fine \$250" are not provided at the 4 accessible parking stalls.	
State: 1129B.4	
Federal: -	
<b>Provide or modify accessible spaces</b>	<b>\$50</b>
Notes: In one of the accessible parking stalls, the ISA is faded. Repaint.	
State: 1129B.4	
Federal: 4.6.4	
<b>Install sign for unauthorized parking</b>	<b>\$400</b>
Notes: Tow-away sign is not provided.	
State: 1129B.4, 1133B.8.6.3	
Federal: -	
<b>Install van parking sign</b>	<b>\$250</b>
Notes: Van accessible parking sign is not provided.	
State: 1129B.4	
Federal: 4.6.4	
<b>Provide or modify accessible access aisles</b>	<b>\$200</b>
Notes: The 4 access aisles do not have blue borders.	
State: 1129B.3 #1, 1129B.4 #1	
Federal: 4.6.3	
<b>Regrade surface</b>	<b>\$9,000</b>
Notes: Slopes in 2 of the accessible parking spaces and slopes in 3 of the access aisles exceed 2% (2% max). Regrade slopes to not exceed 2% in any direction.	
State: 1129B.3 #4	
Federal: 4.6.3	



West Plaza Parking Lot  
Healdsburg, CA

**Healdsburg**  
West Plaza Parking Lot

<b>Exterior</b>		
<b>1 - 1</b>	<b>Parking Area</b>	<b>Priority:</b>
<b>Install sign for unauthorized parking</b>		<b>\$400</b>
Notes: Tow-away sign is not provided.		
State: 1129B.4, 1133B.8.6.3		
Federal: -		
<b>Install sign</b>		<b>\$400</b>
Notes: There are 4 accessible parking spaces. Additional language stating "Minimum Fine \$250" are not provided.		
State: 1129B.4		
Federal: -		
<b>Install sign</b>		<b>\$100</b>
Notes: The words 'NO PARKING' are not painted in the 2 access aisles.		
State: 1129B.3 #1, 1129B.3 #2		
Federal: -		
<b>Provide or modify accessible access aisles</b>		<b>\$300</b>
Notes: The 2 access aisles do not have blue borders. Van accessible parking space does not provide 98" min. access aisle. Switch the van accessible parking space sign with the other accessible parking space sign.		
State: 1129B.3 #1, 1129B.3 #2, 1129B.4 #1		
Federal: 4.6.3		
<b>Install sign</b>		<b>\$100</b>
Notes: One of the accessible parking space signs is obstructed by tree branches.		
State: 1129B.4		
Federal: -		
<b>Regrade surface</b>		<b>\$10,800</b>
Notes: Slopes in the 4 accessible parking spaces exceed 2%. Slopes in the 2 access aisles exceed 2%. Regrade slopes to not exceed 2% in any direction.		
State: 1129B.3 #4		
Federal: 4.6.3		
<b>Provide or modify accessible spaces</b>		<b>\$7,650</b>
Notes: There are a total of 228 parking spaces and 4 accessible parking spaces. A total of 7 accessible parking spaces are required. Provide 3 additional accessible parking space.		
State: 1129B		
Federal: 4.1.2(5)(b)		

**Healdsburg**  
West Plaza Parking Lot

<b>Exterior</b>	
<b>3 - 1</b>	<b>Curb Ramp</b> <span style="float: right;">Priority:</span>
<b>Provide detectable warning strip</b>	<b>\$1,000</b>
Notes: Detectable warnings are not provided.	
State: 1127B.5 #7	
Federal: 4.7.7	
<b>Provide surface texturing</b>	<b>\$300</b>
Notes: Surface material does not contrast with surrounding sidewalks.	
State: 1127B.5 #5	
Federal: -	